


Some on here have added a MDI Media player to there cars, I thought that I would like to have the AUX-in Socket like the factory fitted and to replace the black tab that covers the hole in the armrest cover.

Dimensions for cut out for the plug in the armrest cover.



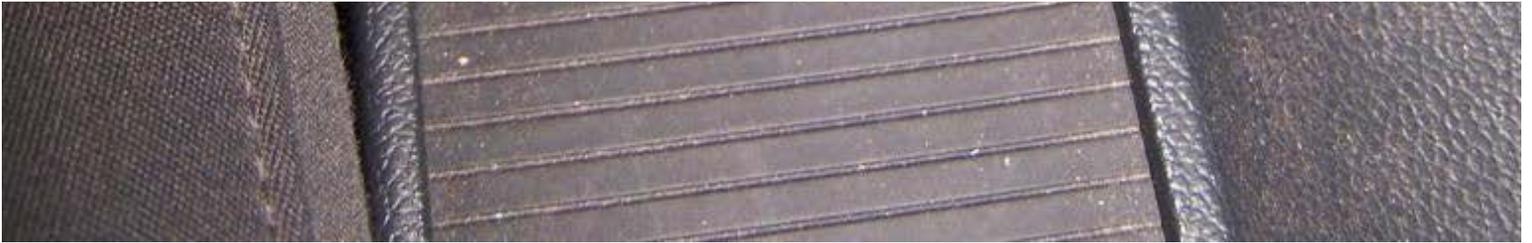


The parts required

5M0 035 724 Aux-in Socket

8K0 973 754 Plug for Aux-in Socket

3x 000 979 009E Repair wires (As I made my own loom I just crimped the wires which match the factory colour)

My loom

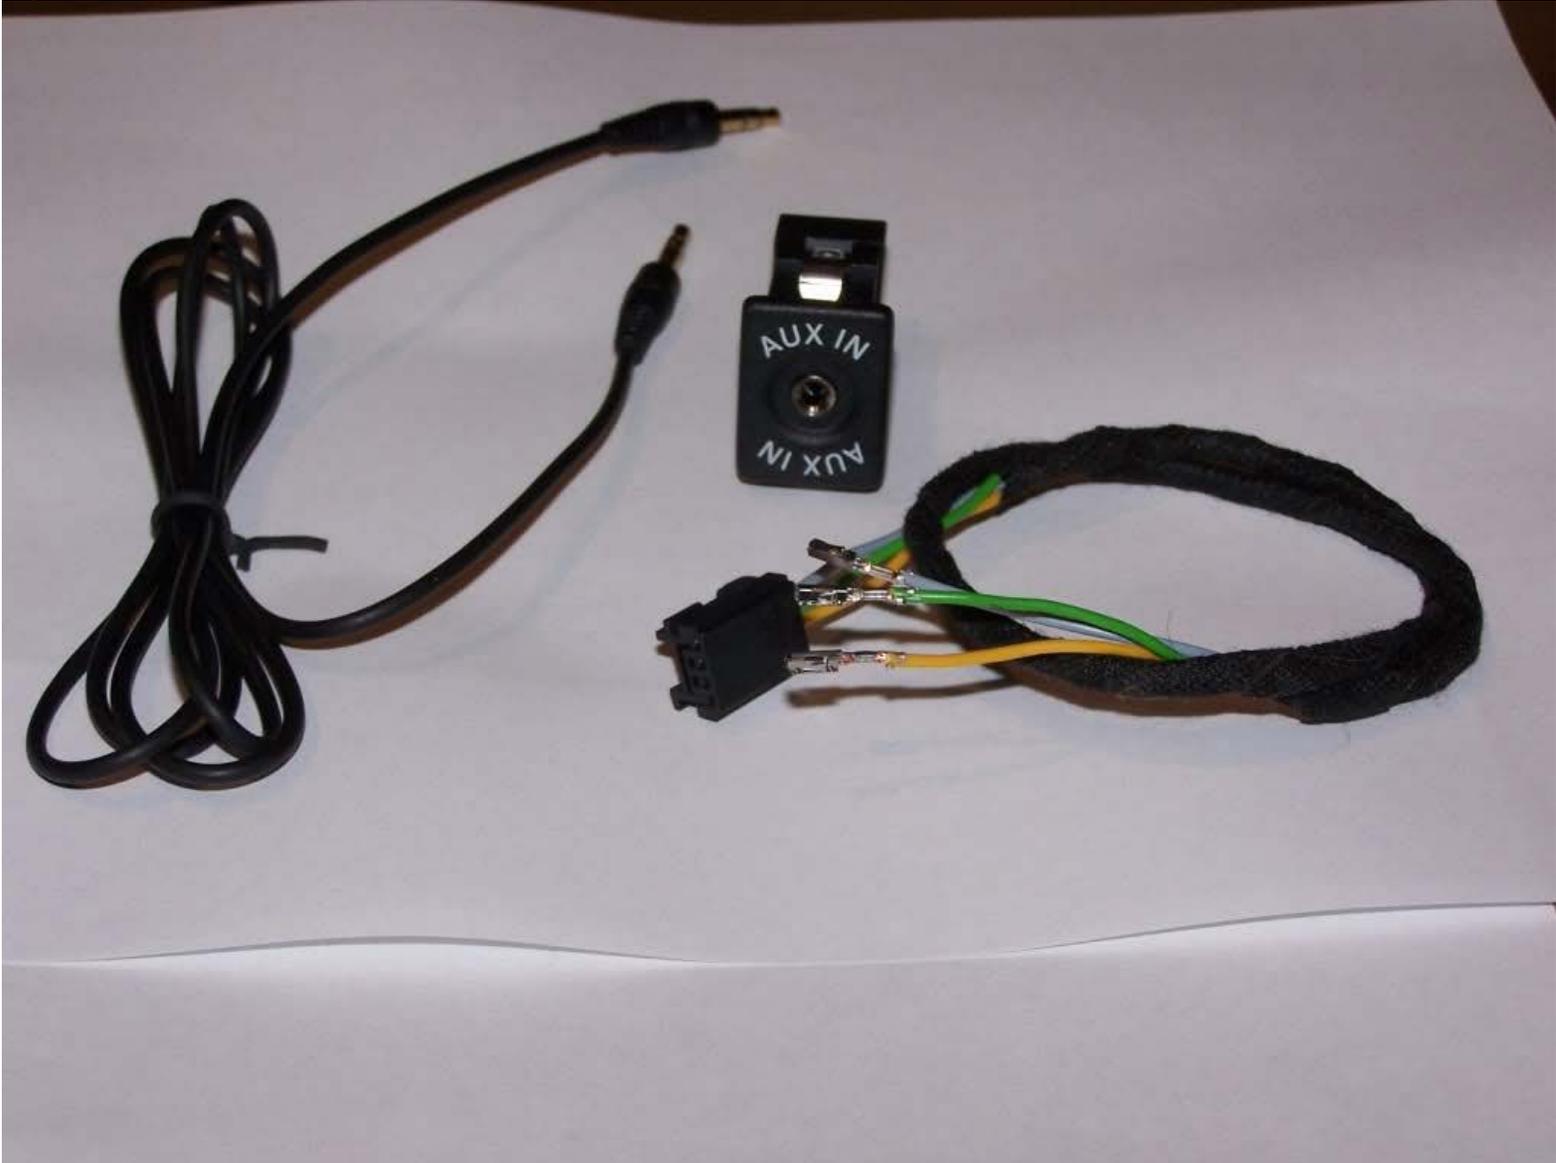

Insert the wires

MDI Plug
Pin 5 >

Aux-In plug
Pin 3

Pin 11	>	Pin 2
Pin 6	>	Pin 1

Code the Radio for Aux-in Monitoring and check the settings on the Radio.

Some of the newer MDI players have a constant fault with the Open circuit due to not having the AUX-in. This should sort that and you have the ability to play tunes from your MP3 player, Laptop etc